

Assembly instruction

Series QLA

No. 9007

Tools and materials required:

Crimp tool 1A
Stanley blade, scissors

Straight connector for flexible cable

Cable entry: SUHNER Full-Crimp

Connector types: (e.g.)

11 QLA-01-2-8c
11 QLA-01-2-9c

11 QLV-01-2-1 无屏蔽型。

This connector is supplied in 3 parts

Suitable cables e.g.:

RG 188 A/U
G 02232
K 02252d

RG 316/U

Centre contact/capt.:





cavity 1

Braid:


cavity A

Crimp tool:

  
1A red

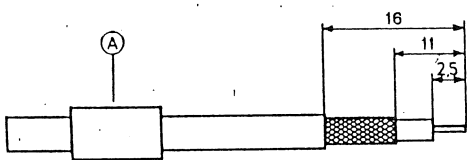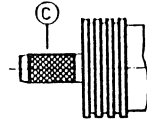


Slide ferrule A onto cable, strip cable according to diagram. Do not damage braid.

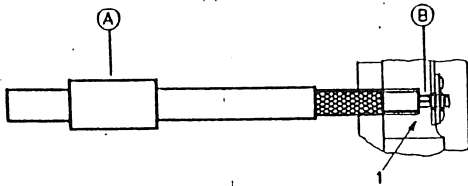


Insert inner conductor of cable into B and crimp with insert 1.

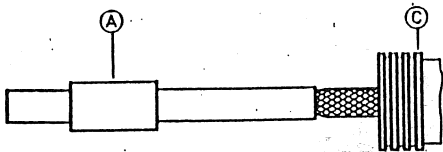

Splay out braid. Insert centre contact B into connector body C as far as stop. Ensure that braid lies above the crimp neck.

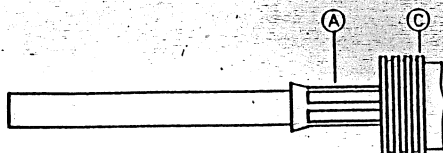

 Slide ferrule A over braid and crimp as close to connector body C as possible.



SUHNER's skilled staff and specialised equipment are available to carry out complete R. F. lead-assembly on your behalf. We mount your connectors on cables at economic prices! Please contact our representative for further details of this service.



HUBER+SUHNER LTD. CH-9100 HERISAU